


APPLICATIONS

Make & Model	Year	Comment
AUDI		
A3	2005>	Inc BOSE
A4	2005>	Inc 08 BANG & OLUFSON AMPED MODELS
TT	2006>	Inc BOSE
Q7	2007>	
BMW		
		Early Models 2003>
1 Series	2005>07	E87 CHECK NOT 08 MODELS
3 Series	2005>07	E90/E91 CHECK NOT 08 Models
3 Coupe	2005>07	E92 CHECK NOT 08 Models
5 Series	2005>07	E60/E61 CHECK NOT 08 Models
Mini	2005>07	
CITROEN		
C2	2005>07	CHECK LATE MODELS
C3	2005>07	CHECK LATE MODELS
C4	2005>07	CHECK LATE MODELS
C5	2005>07	CHECK LATE MODELS
PEUGEOT		
407	2004>	Not JBL system
807	2005>	
607	2005>	
307	2005>	
SEAT		
		All Models
ALTEA	2006>	
LEON	2006>	
TOLEDO	2006>	
SKODA		
		CHECK MUTE POSITION ON LATE MODELS
OCTAVIA	2007>	
SUPERB	2007>	
VAUXHALL		
		CD30/CD40/ CD70 Head Units
ALL MODELS	2004>	
VOLKSWAGEN		
		Delta Head Units
GOLF	2005>	
PASSAT	2005>	
TOURAN	2005>	
TOUAREG	2005>	


e&eo

QUADLOCK DIAGRAMS

FORD HEAD UNITS ARE SUBJECT TO DISTORTION WHEN CONNECTING TO THE TELEPHONE INTEGRATION SYSTEM

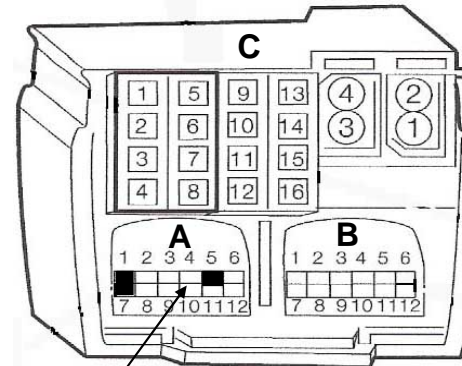

RADIOMUTE

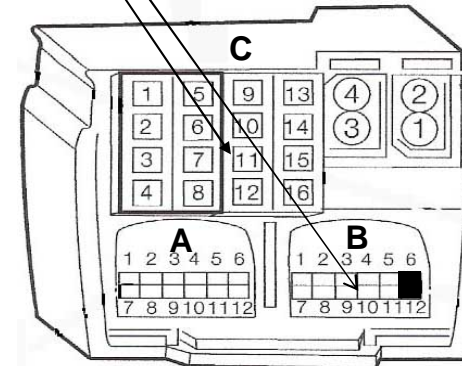

FORD QUADLOCK CONNECTOR

SELECT THE BLACK PLUG IN THE QUADLOCK (A) AND REMOVE BY UNCLIPPING THE TAB. INSERT THE TERMINATED END OF 3.5 JACK, (WHITE) + TO PIN 1 & (BLACK) - TO PIN 7. INSERT THE TERMINATED YELLOW WIRE TO PIN 5 FOR THE MUTE. REASSEMBLE AND PLUG INTO QUADLOCK HOUSING (C)

VAUXHALL QUADLOCK CONNECTOR

REMOVE THE CENTRE SECURING SPLINE ON THE TOP OF THE QUADLOCK HOUSING (C). INSERT THE TERMINATED YELLOW WIRE TO POSITION 11 ON THE POWER BLOCK OF THE QUADLOCK HOUSING (C) OR (B) POSITION 10 ON THE 12 PIN CONNECTOR AND REPLACE SPLINE.

SECTION (B) REMOVE SECURING SPLINE ON THE SIDE OF THE QUADLOCK HOUSING (C) AND INSERT THE TERMINATED END OF 3.5 JACK, (RED) + TO POSITION 6 & (BLACK) - TO POSITION 12 & REPLACE SPLINE.

VOLKSWAGEN, AUDI, BMW, CITROEN, PEUGEOT, SKODA, SAAB

FOLLOW THE SAME PROCEDURE AS ABOVE FOR THESE VEHICLES. IN SOME CASES YOU WILL FIND SECTION (B) EMPTY, PLEASE USE THE CONNECTOR & COVER PROVIDED TO COMPLETE THE INSTALLATION.

Please check all connections prior to installation. We do not accept any liability regarding the use of this product, however every precaution has been taken to give accurate information. Note that in some cases PIN identification may differ - please check beforehand.

Contact c-vista ltd 0845 838 0866

